

TEXTILE LABORATORY SERVICES LIMITED

P.O. Box 50, Wharfebank Business Centre, Ilkley Road, OTLEY, LS21 3JP, United Kingdom

Tel: +44 (0)1943 850967 Fax: +44 (0)1943 850965 Email: info@tls-ltd.demon.co.uk

Regd. Office: 3 Victoria Road, Guiseley, England - No.1966147



The test report shall not be reproduced except in full, without written approval of the laboratory

TEST CERTIFICATE

No. 36786/2

Testing to BS 5867 : Part 2 : 2008 : Type B Curtains, Drapes and Blinds

Client **J. & C. Joel Limited**

Corporation Mill
Corporation Street
Sowerby Bridge
HALIFAX
HX6 2QQ.

Fabric Reference **Premier Wool Serge IFR, stated to be wool**

Descriptions are information
supplied by the client

Dimensions (approx) **103cm by 103cm**

Sample received **23/3/2015**

1. TESTING AS RECEIVED

Test results relate only to the sample tested. Three specimens, as received, from both length and width were tested in accordance with BS EN ISO 15025:2002 Procedure A (surface ignition) using a 15 second flame application time. The results obtained (shown in the table below) were assessed according to the requirements of BS 5867 : Part 2 : 2008

The test results may not apply to situations where there is a restricted air supply or prolonged exposure to large sources of intense heat as in a conflagration. The second specimen in each direction was tested in the inverse direction to the other two specimens. Testing was carried out on the face side of the fabric. The following results were noted.


Specimen	1	2	3	4	5	6
Flame reached an edge	No	No	No	No	No	No
Hole reached an edge	No	No	No	No	No	No
Flaming Debris separated	No	No	No	No	No	No

Requirements: Any "Yes" means fail except if only one specimen fails a further 6 specimens are tested, if the second 6 specimens all pass the result is a pass.

Result in 'as received' condition: **Pass**

PRE-TREATMENT

If the fabric is a PASS in the 'as received' condition then the fabric undergoes a water soak as per BS EN 1021 Annex D or BS 5651

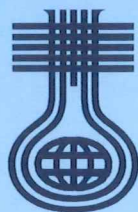

TEXTILE LABORATORY SERVICES LIMITED

P.O. Box 50, Wharfebank Business Centre, Ilkley Road, OTLEY, LS21 3JP, United Kingdom

Tel: +44 (0)1943 850967 Fax: +44 (0)1943 850965 Email: info@tls-ltd.demon.co.uk

Regd. Office: 3 Victoria Road, Guiseley, England - No.1966147



2. TESTING AFTER PRE-TREATMENT

Test results relate only to the sample tested. Three specimens, after pre-treatment, from both length and width were tested in accordance with BS EN ISO 15025:2002 Procedure A (surface ignition) using a 15 second flame application time. The results obtained (shown in the table below) were assessed according to the requirements of BS 5867 : Part 2 : 2008

Specimen	7	8	9	10	11	12
Flame reached an edge	No	No	No	No	No	No
Hole reached an edge	No	No	No	No	No	No
Flaming Debris separated	No	No	No	No	No	No

Requirements: Any "Yes" means fail except if only one specimen fails a further 6 specimens are tested, if the second 6 specimens all pass the result is a pass.

Result after pre-treatment: **Pass**

CONCLUSION

The fabric meets the Type B performance requirements of BS 5867 : Part 2 : 2008

The material should be identified with the manufacturers name, trademark or other identifying mark, the statement 'Flammability complies with the requirements of BS 5867 : Part 2, Type B and instructions of any special precautions to be taken concerning care (including cleansing) of the curtain, drape or window blind to be manufactured from the fabric, preferably using an appropriate care labelling symbol in accordance with BS EN 23758 and taking account of the pre-treatment used in this test and the requirements of Clause 4 of BS 5867 : Part 2 : 2008. If the fabric is unsuitable for cleansing, this shall be stated.

J.M. Brown
C Chem MRSC C Text FTI
Managing Director & Authorised Signatory

Checked by.....